

SERVICE BULLETIN

No. 300-1-01

Compliance mandatory

Subject: Securing the wire stirrup of the gascolator bowl

Aircraft affected:

EA-300	S/N 1 - 67
EA-300/L	S/N 1 - 133
EA-300/S	S/N 1 - 30
EA-300/200	S/N 1 - 29

Purpose: Safety wiring prevents the wire stirrup from migrating outwards, causing the possibility of an unseated gascolator bowl.

Approval: The technical content of this Service Bulletin has been approved by LBA.


COMPLIANCE TIME:

The safety wire must be installed at the next scheduled inspection.

INSTRUCTIONS:

- Drill a hole (3/32", 2mm) into the bracket (see picture 1).
- Safetywire the stirrup according the picture 2 below. Use safety wire dia. 0.032".
- Make appropriate entry of compliance with this service bulletin in the aircraft log.

Note: Alterations or repair of the aircraft must be accomplished by licenced personell only.

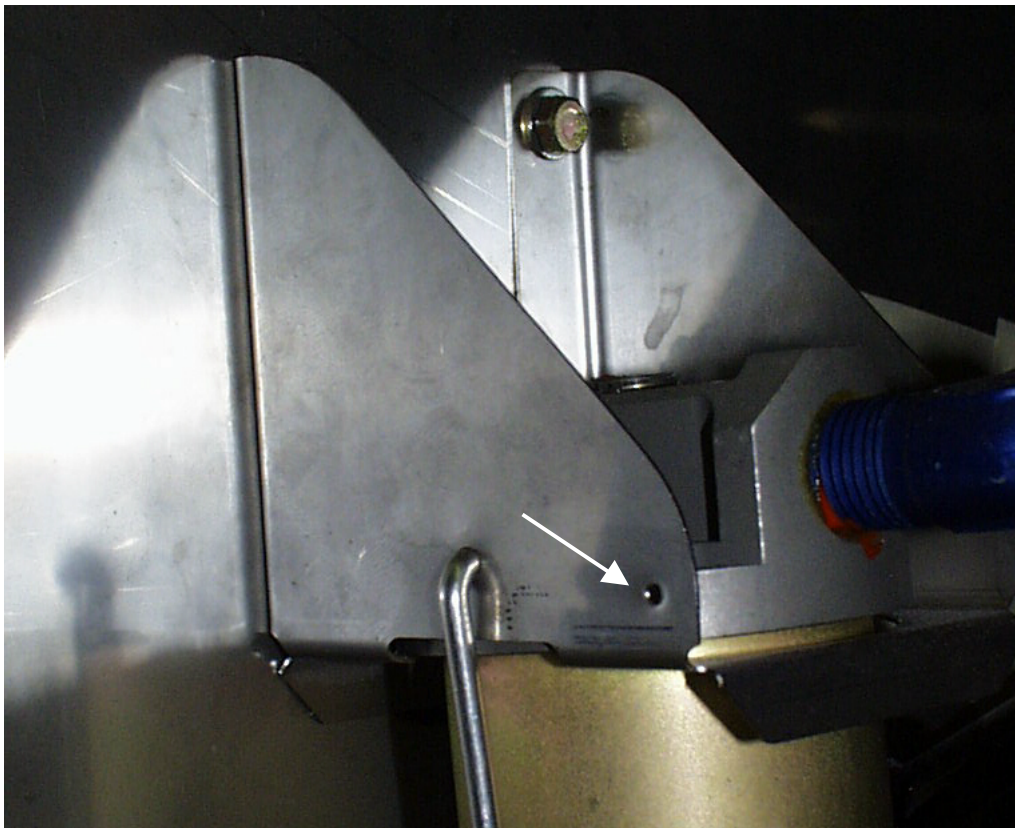

Picture 1



Picture 2